


Models A and R

Model A and R With 6" Stem

All of Stainless Steel (except dial). Hermetically sealed. Model A has external pointer reset.

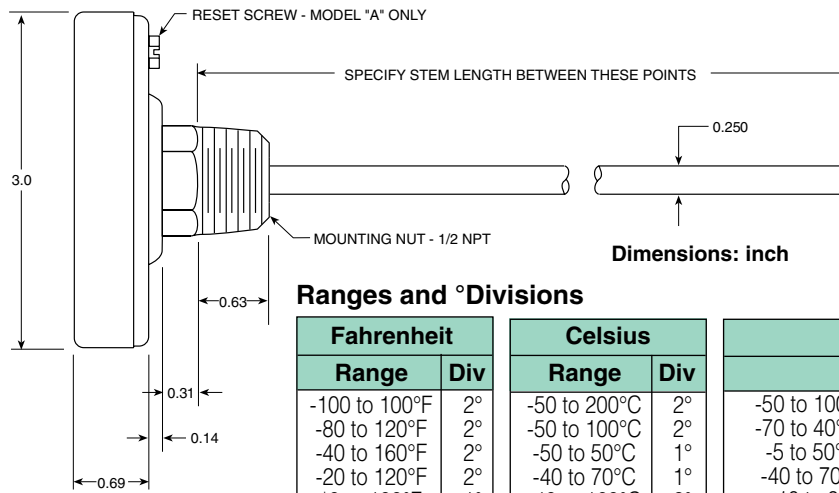

Ranges and °Divisions

Fahrenheit		Celsius		Dual Range	
Range	Div	Range	Div	°C (°F)	Div
-100 to 100°F	2°	-50 to 200°C	2°	-50 to 100°C (-50 to 210°F)	5°/2°
-80 to 120°F	2°	-50 to 100°C	2°	-70 to 40°C (-100 to 100°F)	2°/1°
-40 to 160°F	2°	-50 to 50°C	1°	-5 to 50°C (*25 to 125°F)	1°/1°
-20 to 120°F	2°	-40 to 70°C	1°	-40 to 70°C (-40 to 160°F)	2°/1°
*0 to 100°F	1°	-40 to 160°C	2°	-10 to 90°C (0 to 200°F)	2°/1°
0 to 140°F	2°	*-30 to 30°C	1°	-20 to 120°C (0 to 250°F)	2°/2°
*25 to 125°F	1°	-20 to 120°C	2°	10 to 150°C (50 to 300°F)	2°/2°
0 to 150°F	1°	-10 to 110°C	1°	10 to 260°C (50 to 500°F)	5°/5°
0 to 200°F	2°	*0 to 50°C	½°	10 to 290°C (50 to 550°F)	5°/5°
0 to 220°F	2°	0 to 100°C	1°	70 to 400°C (150 to 750°F)	10°/5°
0 to 250°F	2°	0 to 150°C	1°	100 to 500°C (200 to 1000°F)	10°/5°
0 to 300°F	2°	0 to 200°C	2°	-20 to 70°C (0 to 150°F)	10°/5°
20 to 240°F	2°	0 to 300°C	2°	-10 to 115°C (20 to 240°F)	10°/5°
-50 to 300°F	5°	0 to 400°C	5°	10 to 200°C (50 to 400°F)	10°/5°
50 to 300°F	2°	100 to 500°C	5°	100 to 500°C (200 to 1000°F)	10°/5°
50 to 400°F	5°	-80 to 220°C	5°		
50 to 500°F	5°	*0 to 60°C	5°		
50 to 550°F	5°	0 to 250°C	5°		
50 to 750°F	10°	100 to 550°C	5°		
100 to 800°F	10°				
150 to 750°F	10°				
200 to 1000°F	10°				
250 to 600°F	10°				
-100 to 200°F	10°				
-70 to 150°F	10°				

To order A and R, specify*:

Model - Range - Stem Length - Mounting

Ordering Examples: A-0-250F-9-1/2, model A with 0 to 250°F range, 9" stem and ½ NPT bushing.

A-0-140F-21/2-1/2, model A with 0 to 140°F range, 2½" stem and ½ NPT mounting.

R-50-400F-21/2-1/2, model R with 50 to 400°F range, 2½" stem and ½ NPT mounting.


* For stem lengths, pricing visit us online

* Minimum stem length 4".

Models B and S

Model S With 6" Stem

All of Stainless Steel (except dial). Hermetically sealed. Model B has external pointer reset.

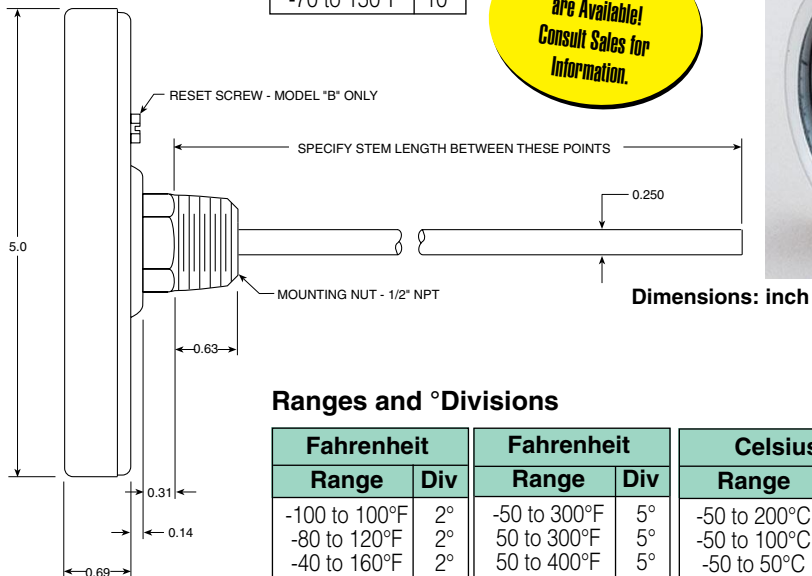

Ranges and °Divisions

Fahrenheit		Fahrenheit		Celsius		Celsius	
Range	Div	Range	Div	Range	Div	Range	Div
-100 to 100°F	2°	-50 to 300°F	5°	-50 to 200°C	1°	0 to 200°C	2°
-80 to 120°F	2°	50 to 300°F	5°	-50 to 100°C	1°	0 to 300°C	5°
-40 to 160°F	2°	50 to 400°F	5°	-50 to 50°C	1°	0 to 400°C	5°
*-20 to 120°F	2°	50 to 500°F	5°	-40 to 70°C	1°	100 to 500°C	5°
*0 to 100°F	2°	50 to 550°F	5°	-40 to 160°C	1°	-80 to 220°C	5°
0 to 140°F	2°	50 to 750°F	5°	*-30 to 30°C	1°	-20 to 220°C	5°
*25 to 125°F	5°	100 to 800°F	10°	-20 to 120°C	1°	*0 to 30°C	5°
0 to 150°F	2°	150 to 750°F	10°	-10 to 110°C	1°	*0 to 60°C	5°
0 to 200°F	2°	200 to 1000°F	10°	*0 to 50°C	1°	0 to 250°C	5°
0 to 220°F	5°	-100 to 200°F	10°	0 to 100°C	1°	50 to 450°C	5°
0 to 250°F	5°	-70 to 150°F	10°	0 to 150°C	2°	100 to 550°C	5°
0 to 300°F	5°	200 to 300°F	10°				
20 to 240°F	5°	300 to 400°F	10°				

To order B and S, specify*:

Model - Range - Stem Length - Mounting

Ordering Examples: B-50-300F-9-1/2, model B with 50 to 300°F range, 9" stem and ½ NPT bushing.

B-0-200C-21/2-1/4, model B with 0 to 200°C range, 2½" stem and ¼ NPT mounting.

S-25-125F-4-1/2, model S with 25 to 125°F range, 4" stem and ½ NPT mounting.

* For stem lengths, pricing visit us online

* Minimum stem length 4".

Dual Ranges are Available! Consult Sales for Information.



Shown smaller than actual size.